



How to Order



Pad unit ZP2 —


With adapter **ZP2** —

② Pad diameter

③ Material

④ Vacuum inlet

- For adsorption of work pieces with bumps.

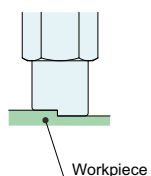

① Vacuum inlet direction	
T	Vertical

② Pad diameter(mm)	
06	ø6
08	ø8
10	ø10
15	ø15


③ Material	
S	CR sponge (With double-sided tape)

④ Vacuum inlet	
A5	M5x0.8(Male)
B5	M5x0.8(Female)

Dimensions

(mm)





S	Sponge Pad
----------	-------------------

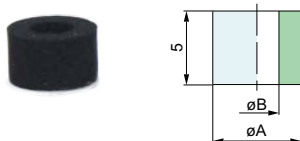


Model	②	③	øA	øB
	Pad dia.	Pad Material		
ZP2	06	S	6	3
	08		8	4
	10		10	6
	15		15	10

Model for refer: **ZP2-06S**

Adapter Mounting Dimensions

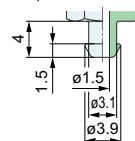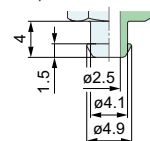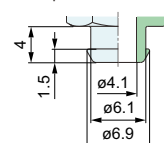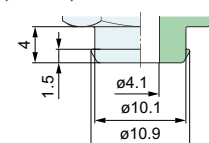Applicable pad: **06S**Applicable pad: **08S**Applicable pad: **10S**Applicable pad: **15S**


ZP2-T	Vertical	A5
-------	----------	----

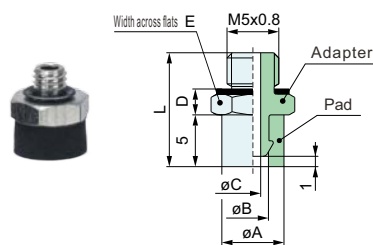

Model	① Vacuum inlet direction	② Pad dia.	③ Pad Material	④ Vacuum inlet	øA	øB	øC	D	E	L	Adapter
ZP2	T	06	S	A5	6	3	1.5	2.5	7	11	ZP2A-S02P
		08			4	2.5	8		ZP2A-S03P		
		10			6		3.5	10	12	ZP2A-S04P	
		15			10	15		ZP2A-S05P			

Model for refer: **ZP2-T06S-A5**

ZP2-T	Vertical	B5
-------	----------	----

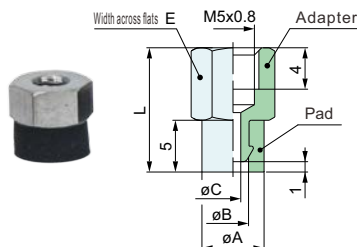

Model	① Vacuum inlet direction	② Pad dia.	③ Pad Material	④ Vacuum inlet	øA	øB	øC	E	L	Adapter
ZP2	T	06	S	B5	6	3	1.5	7	12	ZP2A-S12
		08			8	4	2.5	8		ZP2A-S13
		10			10	6	4.1	10	10	ZP2A-S14
		15			15	10		15		ZP2A-S15

Model for refer: **ZP2-T06S-B5**